



The **DCS3-101045** piezoelectric stack consists of multiple chips which are bonded via epoxy. It offers a maximum displacement of 50.0 μ m. The red wire of the electrode serves as the positive terminal (+), and the black wire is the negative terminal (-).



DCS3-101045

Performance Parameters

Drive Voltage Range	-30~150 V	Capacitance	15.0μF ± 15%
Displacement (Free Stroke) at 150 V	$50.0~\mu m \pm 15\%$	Dissipation Factor	<2.3%
Hysteresis	<15%	Resonant Frequency	27kHZ
Stiffness	80 N/μm	Blocking Force at 150 V	4000N
Curie Temperature	230 °C	Operating Temperature	-25 ~ 130 °C
Product Size	L: 10.0mm	Outer Dimensions	L: 10.3 ± 0.2mm
	W: 10.0mm		W: 12.0 ± 0.2mm
	H: 45.0mm		H: 45.0 ± 0.1mm


- All specifications are quoted at 25°C, unless otherwise stated.
- The displacement may vary slightly for different loads, and the maximum displacement occurs when used with the recommended load.






Product Size 运动方向 正极(75mm) 12.0mm 负极(75mm) 45mm 10.3mm

Performance Curve

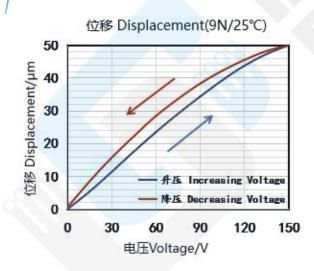

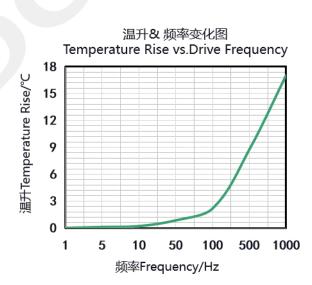

These temperature rises were measured after applying a sine-wave drive voltage ranging from 0 to 150V at the specified frequency for 10 minutes.





Matters Needing Attention

1. Storage Conditions & Precautions:

Temperature: <50 °C, Humidity: <40%Rh. Avoid impact and compression. Store in vacuum-sealed bags for long-term preservation. When not in use, connect to a resistive discharge (\geq 100k Ω) or short-circuit (for low-capacitance ceramics).

2. Operating Conditions & Precautions:

Temperature: Maximum operating temperature $\leq 130^{\circ}$ C (preferably $< 60^{\circ}$ C). Add heat dissipation measures if temperature exceeds 80° C.

Humidity: <50%Rh. In high-humidity environments, preheat at low voltage before use to avoid creepage discharge.

Dust Avoidance: Dust adhesion on ceramic surfaces may reduce insulation resistance.

Clearance: Maintain a gap >1.6mm between ceramics and other conductors.

Safety: Do not immerse piezoelectric stacks in organic solvents or expose to flammable gases/liquids.

3. Assembly Precautions:

Polarity: Red wire = positive (+), black wire = negative (-). Reverse polarity may cause mechanical failure.

Handling: Handle with care to avoid impact. Wear gloves to prevent oil contamination.

Fit Tolerance: Assemble with clearance fit first, then tighten. Avoid interference fit to prevent ceramic compression.

Electrostatic Protection: Maintain >1.6mm gap between ceramics and metal parts to avoid static discharge.

Adhesive Bonding: Ensure flat bonding surfaces and remove excess glue to minimize contamination.

Soldering: Limit contact time under high temperature to <1 second to protect ceramics and coatings.

High-Temperature Assembly: Control temperature <120 $^{\circ}$ C to prevent depolarization, adhesive failure, or coating damage.

4. Preload Instructions:

Load Application: Apply external load to the center of the stack or distribute uniformly on the mounting surface. Ensure contact surfaces are flat and smooth.

Guangdong DCpiezo Technology Co., Ltd.





Force Direction: Piezoelectric stacks can only withstand axial forces. Shear or torsional forces may cause mechanical failure.

Preload Force: Preload should not exceed 40% of maximum blocking force, and its direction must align with the motion axis to minimize shear stress.

